

Manhole Inspection Summary

Manhole # S06YY1012MH

Printed On: 12/17/2008

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **06YY1** Node: **012** Status: **Found**

Insp Date: **6/21/06 8:51 AM**

Incomplete Comments

Crew: **CH, IJ**
Inspector: **Hale, C**
Firm: **RKK**

Location Address: **4014 CLARKS LN** Cross Street: **REISTERSTOWN RD**

Manhole Type: **Junction** Location: **Roadway** Ground Conditions: **Dry**
☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments **The I6 pipe seal is not flush to the pipe. The O12 pipe picture shows grease deposits inside of the pipe. Clarks Ln (alley behind). 6707 Reisterstown Rd. (behind)**

Cover Shape: **Circular** Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)
Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**
Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **0** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment ☒ Exists Material: **Brick** ☐ Parged Height: **3** (in.)
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated
Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☒ **Mortar** ☐ Roots ☐ Wall

Corbel Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated
Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

Barrel Material: **Brick** ☐ Parged
Shape: **Circular** Diameter: **42** (in.) Length: (in.)
Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**
Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

Bench ☒ Exists Material: **Brick** ☐ Parged ☐ Debris (not Condition related)
Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

Channel Material: **Brick** ☐ Parged ☐ Debris (not Condition related)
Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps Count: **4** Missing: **0** ☒ **Corroded**

Surcharge ☒ **Evidence Of Surcharge** Depth: **1** (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S06YY1012MH

Printed On: 12/17/2008

Page 2 of 4

Location View



Top View



Adjustment, Corbel and Barrel infiltration.
Evidence of surcharge - Bench debris.

Manhole Inspection Summary

Manhole # S06YY1012MH

Printed On: 12/17/2008

Page 3 of 4

8 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **7.95** (ft.) Flow Characteristics: **Fast**

Deposits: ☐ None ☐ Mud ☐ Sludge ☐ Debris ☒ Grease

Silt Depth: **0** (in.) Deposits Extent: **Light**

Infiltration: **Evidence** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer Pipe In @ 3 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **7.85** (ft.) Flow Characteristics: **None**

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ Debris ☒ Grease

Silt Depth: **1** (in.) Deposits Extent: **Light**

Infiltration: **Evidence** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Stub connection / abandoned**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S06YY1012MH

Printed On: 12/17/2008

Page 4 of 4

8 in. Circular Gravity Sewer

Pipe In @ 6 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **7.69** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Unknown**


Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer

Pipe In @ 9 O'Clock

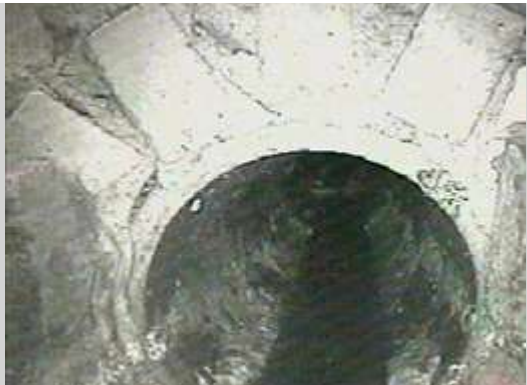

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **7.90** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☐ Mud ☐ Sludge ☐ Debris ☒ Grease

Silt Depth: **0** (in.) Deposits Extent: **Light**

Infiltration: **Evidence** Pipe Seal Cond: **Roots**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection